

检测报告

Test Report

报告编号

Report No. ROCKB202003004-3

产品名称
Product Name

石墨填料 M800
Graphite Packing M800

委托单位
Customer

浙江喜鹊密封件有限公司
Zhejiang Magpie Sealing Element Co., Ltd.

委托单位地址
Customer's Address

浙江省温州市永嘉县瓯北街道浦一村谢宅巷 9 号
No.9 Xiezhai Alley, Puyi Village, Oubei Street,
Yongjia County, Wenzhou City, Zhejiang Province

试验起始日期
Date Started

2020 年 6 月 12 日
June 12, 2020

试验结束日期
Date Finished

2020 年 6 月 15 日
June 15, 2020

浙江岩石机械检测有限公司
Zhejiang Rock Mechanical Inspection and Testing Co., Ltd.



声明 Statement

1. 检测报告封面无公司“检测专用章”、检测报告无“检测专用章”骑缝、检测报告结论无“检测专用章”或无审核人、批准人签字无效。

The report is invalid without “Dedicated Inspection Stamp” on report cover and cross pages and on conclusion, or without signature of reviewer and approver.

2. 报告涂改无效。

Report is invalid if altered.

3. 本公司仅对正式报告负责，任何形式的复印件、传真件、影印件、电子文本仅作参考之用。任何人不得剪辑或部分复制其中的内容。

The company is only responsible for the original report. Any form of copy, fax, photocopy, electronic texts can only be regarded as reference. Editing or partial copy by any party is not allowed.

4. 非本公司抽样，检测报告仅对送检样品负责，委托单位对样品的代表性和相关资料的真实性负责。

Company is not responsible for sampling, therefore the report is only responsible for submitted sample. Customer shall be responsible for the representativity of submitted sample and the authenticity of submitted documents.

5. 委托单位若对检测报告有异议，应于本报告报出之日起三十日内向检测单位提出书面申请。

If customer has any objection to report, written application shall be raised by customer within 30 days after the issue of report.

6. 本公司对不可重复性试验、异议期内不稳定样品、检测无剩余样品等不具备复检条件的委托检测任务，不进行复检。

Company doesn't have the obligation to repeat testing when testing doesn't have repeatability, or samples are not stable during objection period, or sample is used up.

7. 本公司承诺保护委托单位在检测业务中涉及的商业信息、技术文件和商业秘密等，妥善处理相关资料、样品和数据。

Company promises all commercial information, technical document or trade secret related to testing shall be protected, and all documents, samples and data shall be properly handled.

通讯地址：浙江省温州市永嘉县瓯北街道和一工业区

Address: Heyi Industrial Zone, Oubei, Yongjia, Wenzhou, Zhejiang.

邮政编码 Post code: 325000

联系电话 Tel.: 0577-6708 7799

传 真 Fax: 0577-6708 7799


邮 箱 E-mail: rock@rock-lab.cn

网 址 Web: www.rock-lab.cn

填料低泄漏试验信息 Fugitive Emissions Test Information

填料厂家 Manufacturer	浙江喜鹊密封件有限公司 Zhejiang Magpie Sealing Element Co., Ltd.			
填料描述 Description	石墨填料/2 个带金属丝加强编织石墨圈, 3 个模压石墨环 Graphite packing/ 2 nos. of metal-wire-reinforced braided graphite rings, 3 nos. of die-formed graphite rings			
填料材料 Material	石墨 Graphite	填料型号 Model No.	M800	
阀杆运动方式 Stem Motion	升降 Rising	测试时阀杆朝向 Stem Orientation During Test	水平 Horizontal	
抽样方 Selected by	厂家 Manufacturer	送样日期 Collected Date	2020.06.10	
样品编号 Sample No.	ROCKP202003004-3	样品状态 Sample status	完好 Intact	
检测项目 Test Item	密封性能试验 Sealing Performance Test	填料圈数 Number of Rings	5	
填料截面尺寸 (mm×mm) Cross Section Dimensions	6.35×6.35	阀杆直径 (mm) Stem Diameter	25.4	
填料压套内径 (mm) Packing Gland ID	25.5	填料压套外径 (mm) Packing Gland OD	38	
安装后填料压缩量 (%) Packing Compression	17%	推荐填料拧紧扭矩 (N•m) Recommended Gland Tightening Torque	螺母 1 Nut 1	59
			螺母 2 Nut 2	59
试验依据 Test Basis	DIN EN ISO 15848-1: 2017-07 及客户要求 DIN EN ISO 15848-1: 2017-07 and client's requirements			
试验介质 Test Medium	99.999%氦气 99.999% Helium	允许阀杆泄漏量 Allowable Stem Leakage	≤4.52E-05 mbar•l•s ⁻¹ (Refer to BH)	
机械循环总数 No. of Mechanical Cycles	1500 (Refer to CO2)	热循环总数 No. of Thermal Cycles	3 (Refer to CO2)	
试验压力 (MPa) Test Pressure	10.21MPa@RT 6.94MPa@+400℃	试验过程中填料调整次数 Packing Adjustment Nos. During Test	0	
检漏仪品牌/型号/序列号 Leakage Detector Brand/ Model/ Serial Number	Leybold / PHOENIX L300i / 90001197646			
实验室名称及地址 Test Facility	中国浙江省永嘉县瓯北镇和一工业区岩石阀门检测实验室 ROCK Valve Testing Lab, Heyi Industrial Zone, Oubei, Yongjia, Zhejiang,PRC			

试验装置图 Test Rig Diagram:

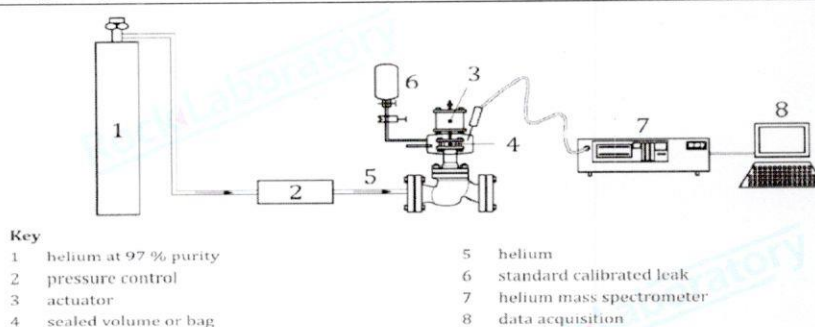

注 Note:

上图所示试验阀门仅为示意，并非代表此次试验结构。Valve image in above picture are for reference, does not represent the structure of test rig.

试验记录 Testing Data

循环数 Cycle Number	试验温度 Test Temperature			压力 Pressure MPa	阀杆净泄漏量 Net Stem Leakage mbar•s ⁻¹	填料扭矩 Gland Nut Torque (Nm)		判定 Evaluation
	TC1-°C	TC2-°C	TC3-°C			螺母 1 Nut 1	螺母 2 Nut 2	
0	RT	RT	RT	10.3	1.41E-08	59	59	合格 Pass
50	RT	RT	RT	10.3	2.45E-08	/	/	合格 Pass
50	400	400	400	6.95	9.02E-08	/	/	合格 Pass
100	400	400	400	6.95	1.18E-06	/	/	合格 Pass
100	RT	RT	RT	10.3	2.96E-06	/	/	合格 Pass
150	RT	RT	RT	10.3	2.65E-06	/	/	合格 Pass
150	400	400	400	6.95	1.09E-05	/	/	合格 Pass
200	400	400	400	6.95	1.35E-05	/	/	合格 Pass
205	RT	RT	RT	10.3	8.75E-06	/	/	合格 Pass
1000	RT	RT	RT	10.3	1.10E-05	/	/	合格 Pass
1000	400	400	400	6.95	2.78E-05	/	/	合格 Pass
1500	400	400	400	6.95	1.43E-05	/	/	合格 Pass
1500	RT	RT	RT	10.3	3.50E-05	40	39	合格 Pass
实测最大泄漏量 Maximum Leakage Detected					3.50E-05			
填料泄漏量是否低于允许值? Was Packing Leakage Below Allowable?					是 YES			

注 Note:


RT 温度范围为+5℃至+40℃。RT is in the range of +5℃ to +40℃.

编制: 袁冬生
Prepared by: 袁冬生
日期: 2020.6.17
Date: 2020.6.17

审核: 胡环
Reviewed by: 胡环
日期: 2020.6.17
Date: 2020.6.17

批准: 邵
Approved by: 邵
日期: 17/6-20
Date: 17/6-20

阀杆泄漏值图表 Stem Leakage Graph

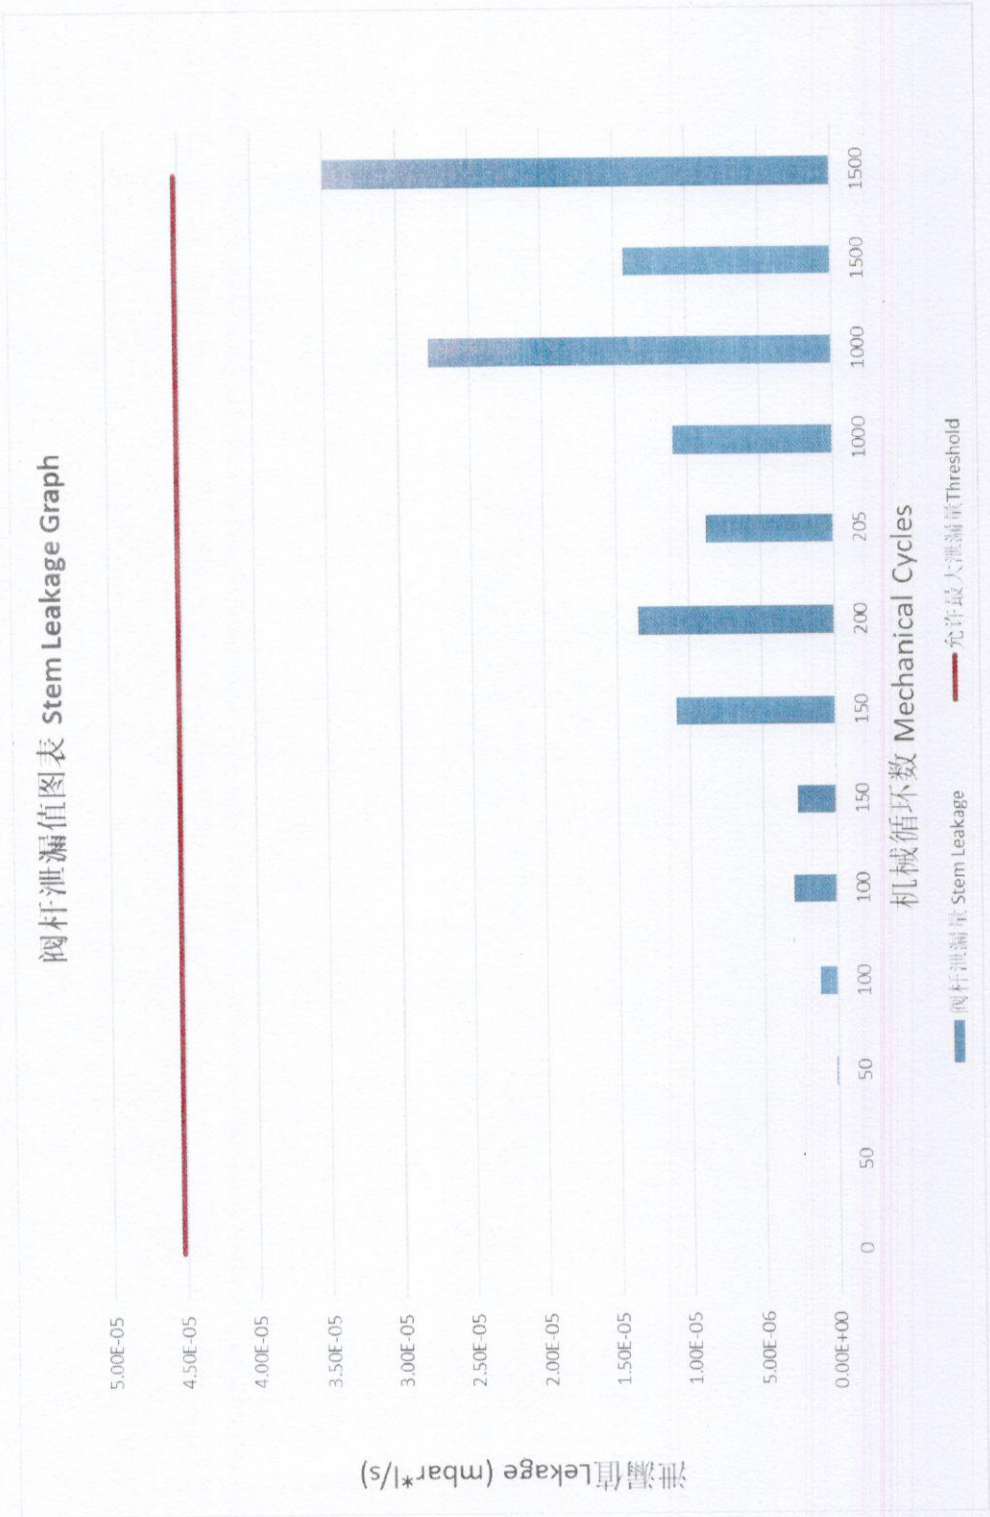

照片记录 Photographic record




试验装置 Test Rig



压缩高度测量 Packing Compression Measurement




试验前的填料环 Packing rings before test

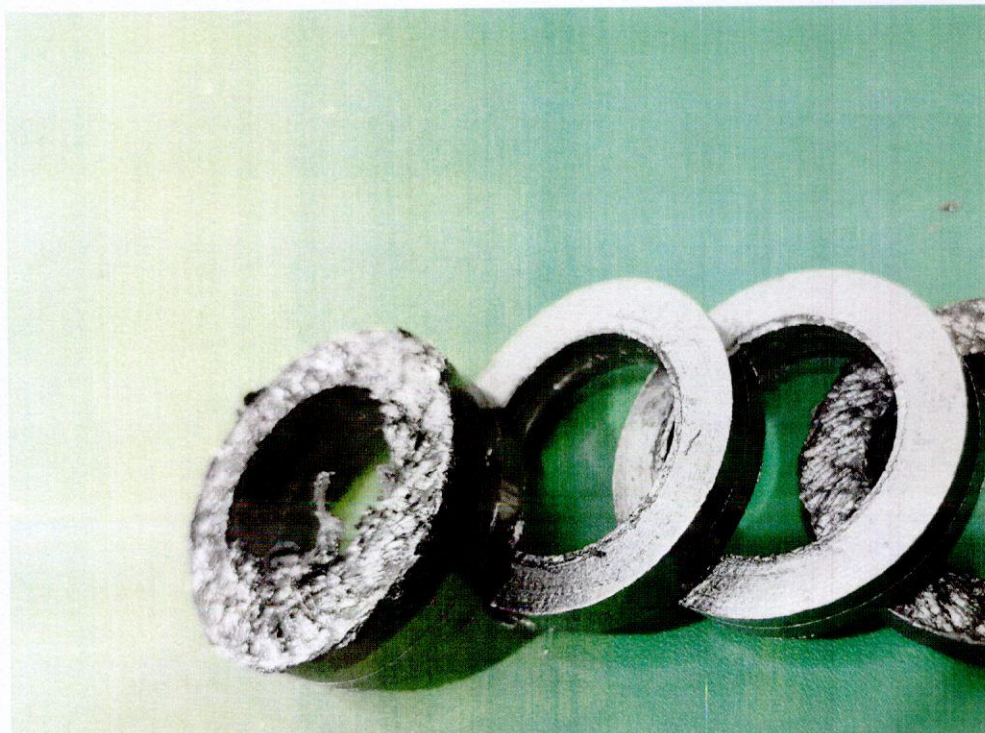


试验后的填料环 Packing rings after test




试验后的填料压套 Gland follower after test

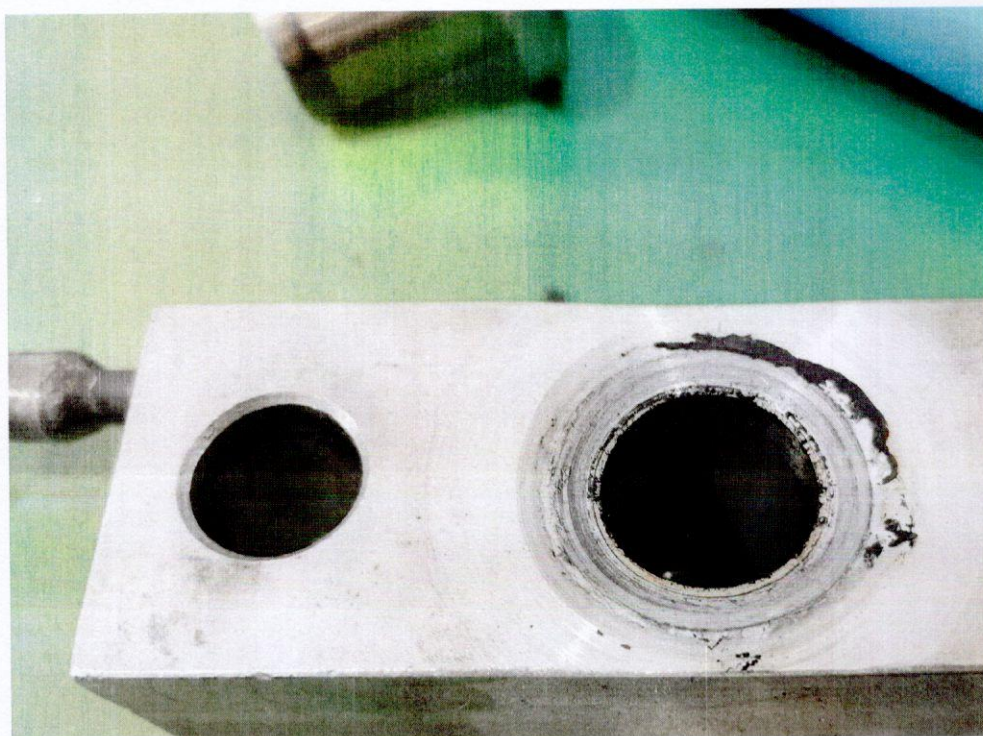

填料压盖 Gland flange

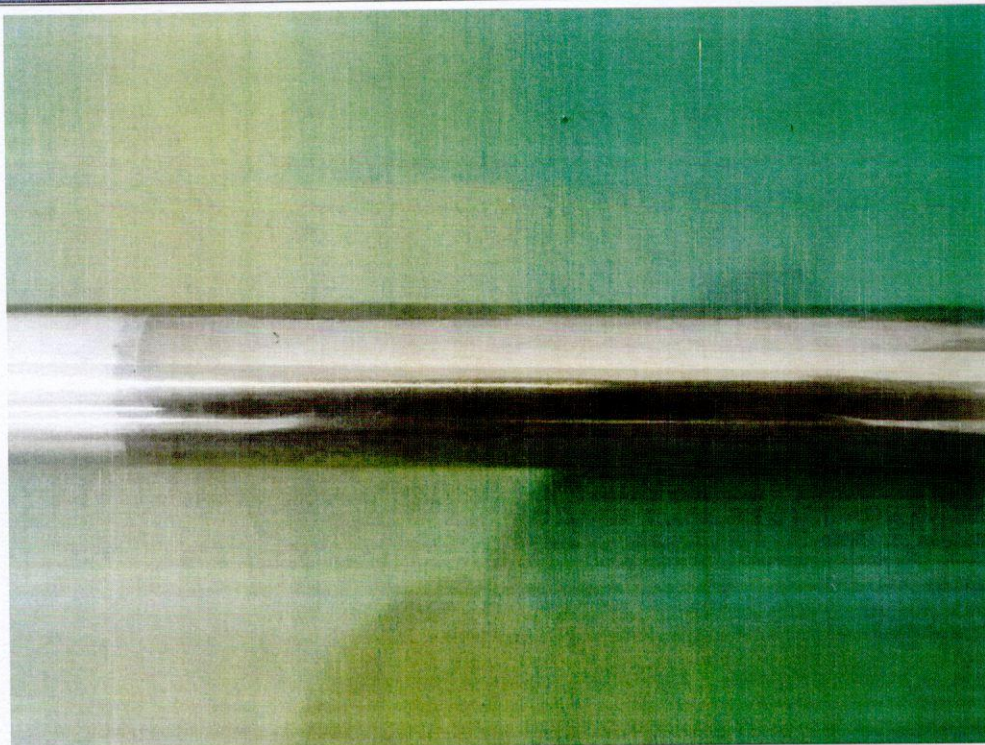


试验后的阀杆 Stem after test

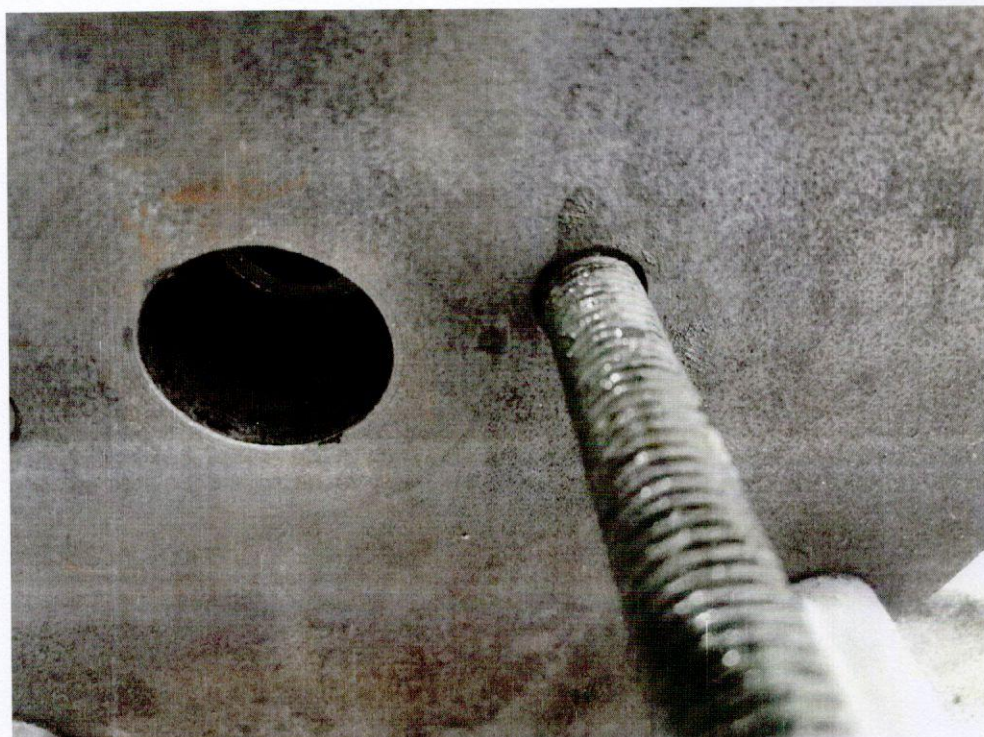

填料函内孔 Stuffing box internal

填料配置图纸 Packing configuration drawing

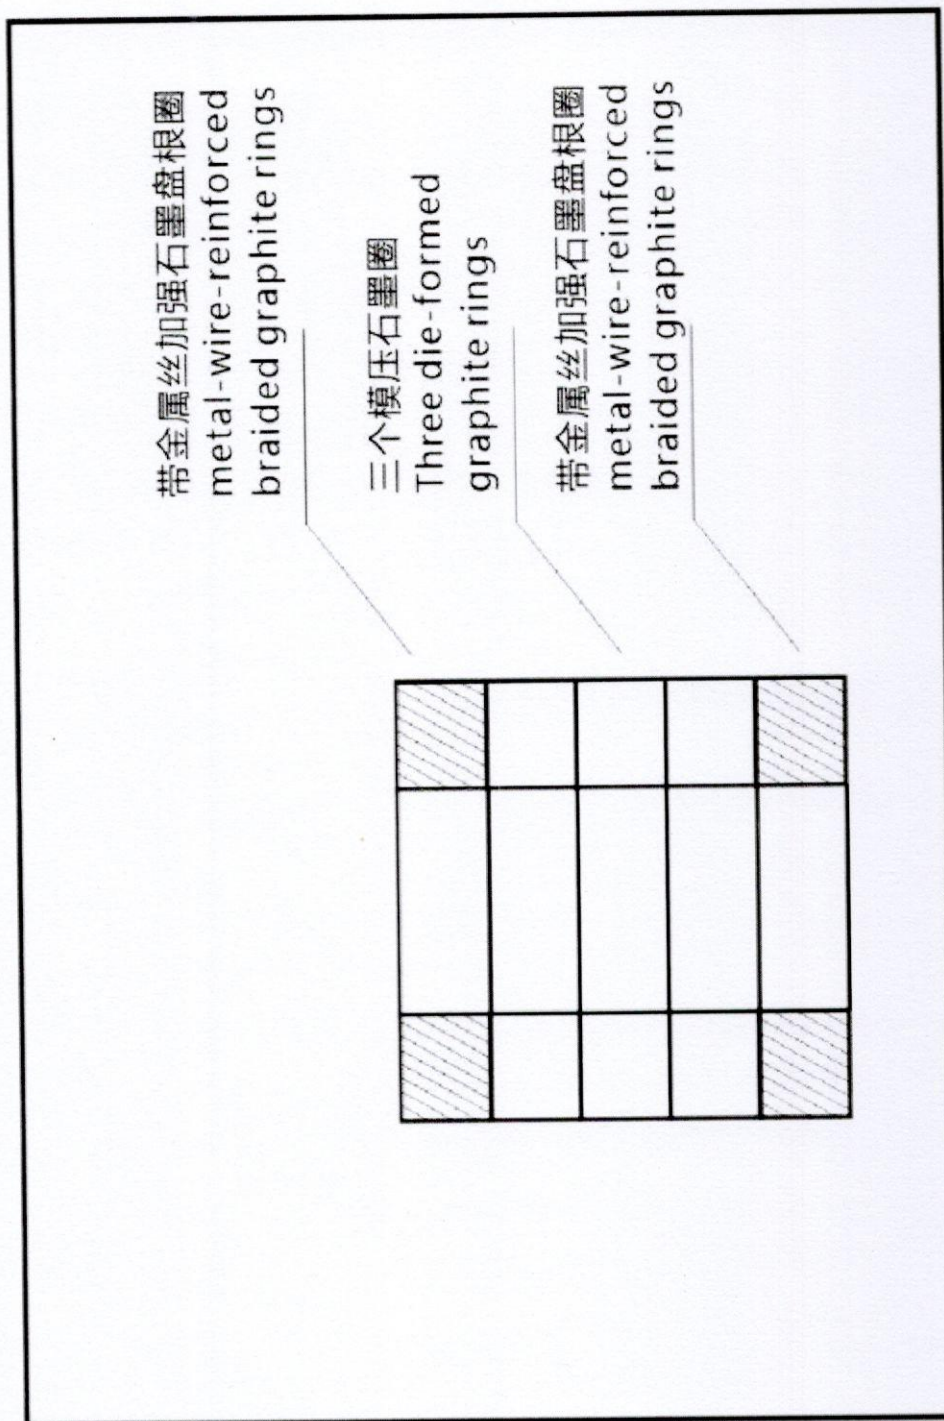

报告结束
End of report